



Product Support Bulletin 2003-014

NORDCO Inc. 182 W. Oklahoma Avenue, Milwaukee, WI 53207

Contact: Gary D. Van Deluyster, Service Manager – Phone: 800-445-9258 – Fax: 414-769-2140

Maintenance of Way ~ Work Equipment Bulletin

DATE: October 28, 2003

SUBJECT: Clamp Arm Proximity Switch Interference

RATING:

<input type="checkbox"/> DIRECTIVE (Action is required)	<input checked="" type="checkbox"/> ALERT (Potential Problem)
<input type="checkbox"/> INFORMATION (Action is optional)	<input type="checkbox"/> PRODUCT IMPROVEMENT (Enhance Product)

MACHINE MODEL(S): Anchor Applicator Model E and F


SERIAL NUMBER(S): 680240-680284

SUMMARY: The Clamp Arm Proximity Switch Actuator can interfere with the Clamp Arm and prevent full extension of the Clamp Arm Cylinder. Only machines with Proximity Switches are affected.

OPERATIONAL IMPACT: The Clamp Arm will not go completely down on 136# and larger rail.

ACTION: A 3/8" – 1/2 " chamfer can be ground in the Clamp Arm can as shown in Figure 2. Alternatively, a redesigned Clamp Arm Cylinder Clevis/Actuator is also available. This clevis will replace the original clevis and is available as p/n 66056860.

WARRANTY: None

 

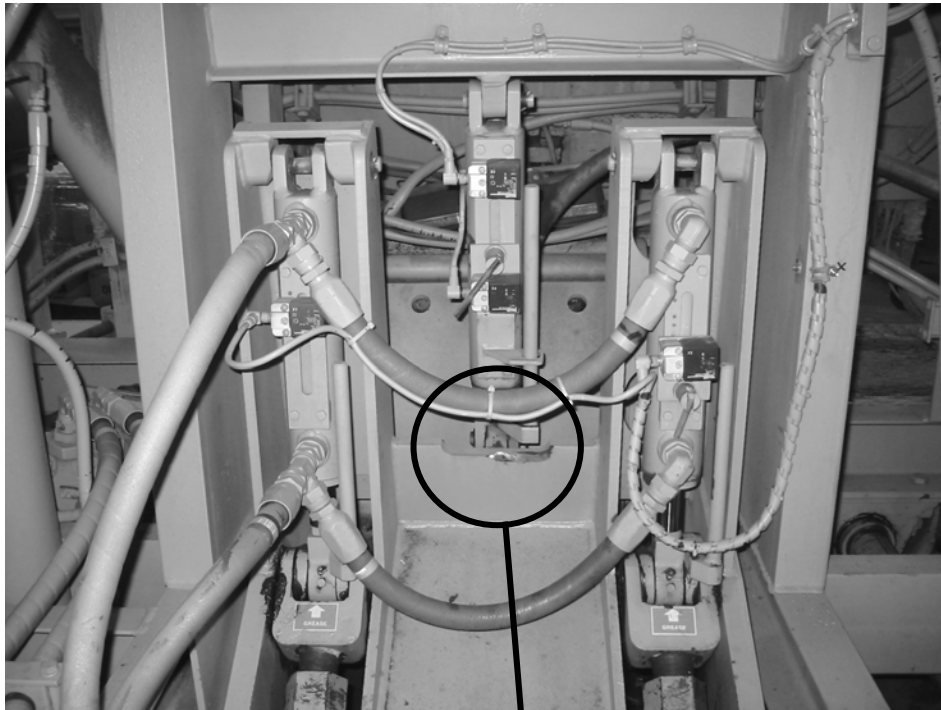


Figure 1

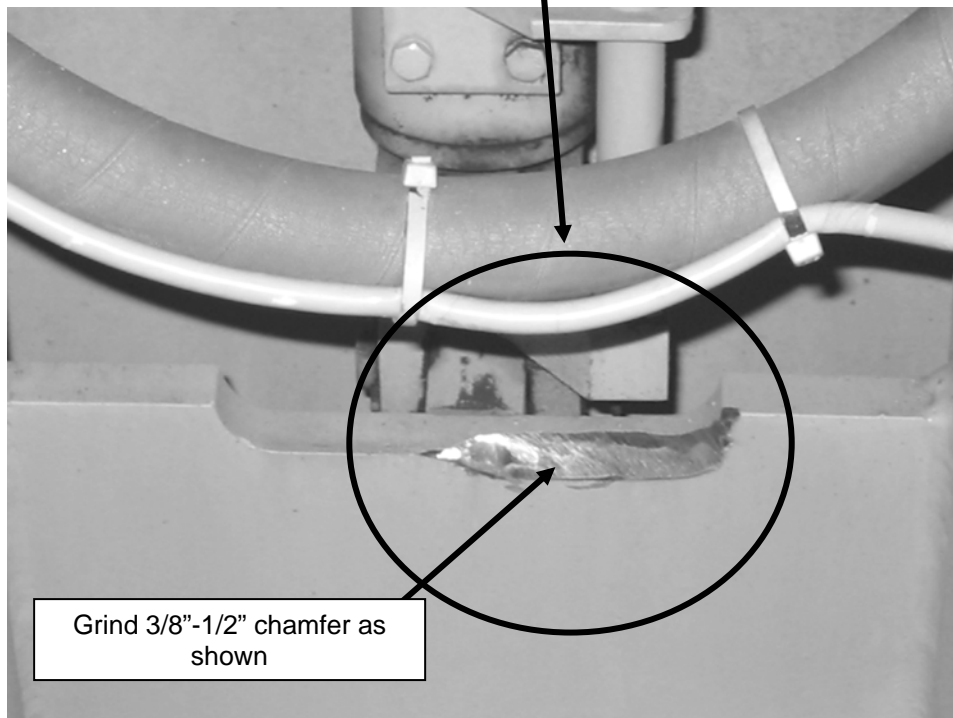


Figure 2