Nordco, Service from the Ground Up

Product Support Bulletin 2009-011

245 W. Forest Hill Avenue Oak Creek, WI 53154

Contact: Gary D. Van Deluyster, Service Manager - Phone: 800-445-9258 - Fax: 414-766-2260

Maintenance of Way ~ Work Equipment Bulletin

DATE:	March 5, 2010		
SUBJECT:	Locking Turntable Cylinder Upgrade Kit – 98410219		
RATING:	DIRECTIVE (Action is required)	ALERT (Potential Problem)	
	X INFORMATION (Action is optional)	PRODUCT IMPROVEM (Enhance Product)	ENT
MACHINE MODEL(S):	CX Hammer		
SERIAL NUMBER(S):	410588-410606		
SUMMARY:	Machines in this serial number range were built with the 28555422 Locking Turntable Cylinder. This cylinder is easily identified by the external lock actuator at the top of the cylinder. See Figure 1 on Page 2. This cylinder is no longer available.		
OPERATIONA IMPACT:	The 28555422 Turntable Cylinder (external lock actuator) has been replaced by the 28555423 Cylinder with an internal lock actuator. The 28555422 cylinder requires Turntable Valve 50078954 and the 28555423 cylinder requires Turntable Valve 50078955 to operate properly. If the 28555422 cylinder is replaced without also replacing the 50078954 Turntable Valve, the locking mechanism will not unlock and the turntable will not function.		
ACTION:	an external lock actuator, the 5 When replacing the 285554: Cylinder Upgrade Kit should Cylinder (internal lock actuator hoses, fittings and hardware ar Valve can be identified by the on Page 2. Note that the pilot	place the 28555422 Locking Turntable Cylin 50078954 Turntable Valve must be replaced 22 Turntable Cylinder, the 98410219 T be ordered. This kit includes a 28555423 had installation instructions. The 50078955 extra port in the valve labeled "DR". See toperated check valve connected to the er must also be removed as shown in Fig.	d as well. Turntable Turntable additiona Turntable Figure 2 cap-end

Page 1 of 3
Please Turn the Page

Page 3.



NORDCO Product Support Bulletin 2009-011

WARRANTY:

Parts will not be supplied under warranty, but installation assistance is available by telephone from the Nordco Service Department. For assistance, please call the Nordco Service Department at 1-800-445-9258.

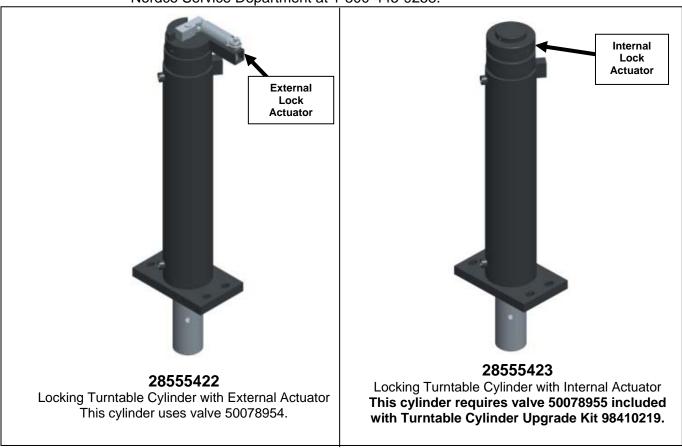


Figure 1
Identifying Locking Turntable Cylinders with External and Internal Lock Actuators

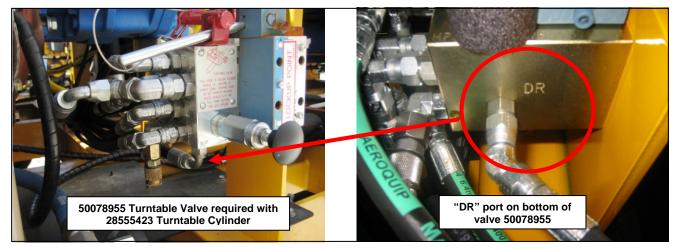


Figure 2

The 50078955 Turntable Valve has a port on the bottom labeled "DR". The 50078954 valve used with the 28555422 Turntable Cylinder does not have this port.

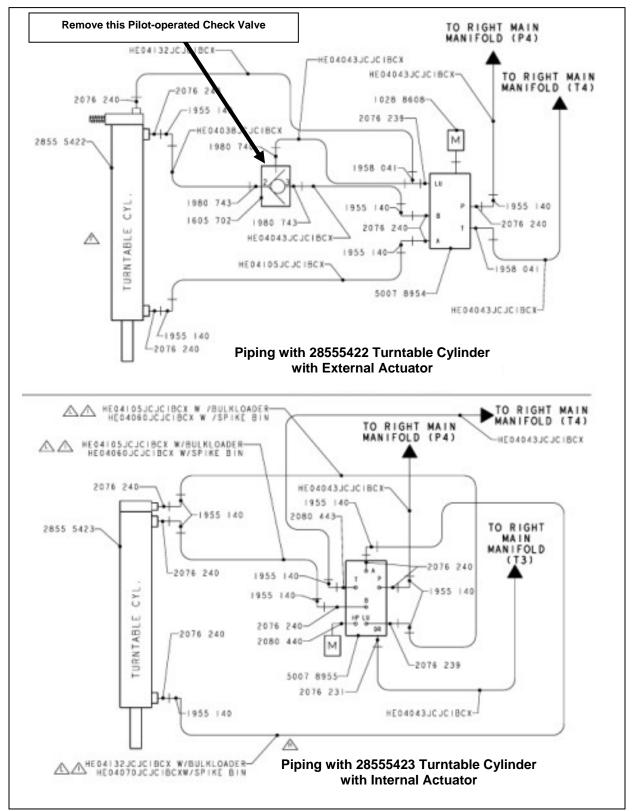


Figure 3

Remove the Pilot-operated Check Valve when replacing the 28555422 Turntable Cylinder with the 28555423 Turntable Cylinder.