Nordco_n Service from the Ground Up

Product Support Bulletin 2009-012

245 W. Forest Hill Avenue Oak Creek, WI 53154

Contact: Gary D. Van Deluyster, Service Manager - Phone: 800-445-9258 - Fax: 414-766-2260

Maintenance of Way ~ Work Equipment Bulletin

DATE:	March 5, 2010		
SUBJECT:	3" Axle Split Collar Spacer – 22553251 3-7/16" Axle Split Collar Spacer – 22553252		
RATING:	DIRECTIVE (Action is required)		ALERT (Potential Problem)
	X INFORMATION (Action is optional)		PRODUCT IMPROVEMENT (Enhance Product)
MACHINE MODEL(S):	CX Hammer C-CX Hammer Conversion CGS – Curve Gang Spiker BAAM – Bulk Automatic Anchor N Anchor Applicator Anchor Remover Grabber – Spike Puller Grabber LS-2 Spike Puller Grabber Conversion SP2R – Dual Rail Spike Puller Model C Spiker 99C Spiker C-RB-UG Hydra-Spiker (Model B only) Hydra-Spiker Model 44 Hydra-Hammer Hydra-Hammer Hydra-Hammer Model B-2 M3 PSS Production Screw Spiker	f lachine	

 
NVCAR – V-Clip Applicator/Remover NSCA – Spring Clip Applicator

NETP - Nordco Epoxy Tie Plugger

RTP – Ride On Tie Plugger

Two-Tie Screw Spiker

Quad Drill Screw Spiker Super B Spiker



NORDCO Product Support Bulletin 2009-012

SERIAL

CX Hammer: 410500-410882 NUMBER(S):

> C-CX Hammer Conversion: 410010RBUG-410424RBUG BAAM – Bulk Automatic Anchor Machine: 690025-690060

Anchor Applicator: 680232-680329 Anchor Remover: 670001-670032

Grabber LS-2 Spike Puller: 330602-330673

Grabber Conversion: 330100RBUG, 330674RBUG SP2R - Dual Rail Spike Puller: 310001-310159

Model C Spiker: 410010-410134 99C Spiker: 410200-410424

Hydra-Spiker (Model B only): 101-162 Hydra-Spiker Model 44: 440001-440006

Hydra-Hammer: 1001-1083 M3 Model C/D: 450200-450242

PSS Production Screw Spiker: 400100RBUG-400111RBUG

Two-Tie Screw Spiker: 400101, 400103

Quad Drill: 120300-120303 Screw Spiker: 450300-450305 Super B/Super B-2 Spiker: 398-713

NETP – Nordco Epoxy Tie Plugger: 510001-510035

RTP - Ride On Tie Plugger: 530001-530015, 530100-530123

NVCAR – V-Clip Applicator/Remover: 140300-140304

NSCA - Spring Clip Applicator: 290025-290031

SUMMARY:

Some machines with 3" and/or 3-7/16" diameter axles have experienced shifting of the axles within the axle pillow blocks. These 3/8" thick Split-Collar Spacers are designed to be installed on the axle between the bearing and the wheel to prevent axle shift. P/N 22553251 is for 3" diameter axles and P/N 22553252 is for 3-7/16" diameter axles. Two Split Collar Spacers are required per axle. These Split Collar Spacers are standard on all machines with 3" and 3-7/16" axles shipped since February, 2009.

OPERATIONAL

IMPACT:

If an axle shifts, the wheel may rub against the frame of the machine. The propel chain

sprockets may also be out of alignment.

ACTION:

Make sure to follow all recommended Lock Out/Tag Out procedures before attempting any repairs.

Some axles may have a solid 3/8" spacer between the bearings and the wheels. These do not have to removed if there is less that 1/16" clearance between the shims/spacer and wheel or bearing. To install the Split Collar Spacers, the axle must first be returned to the normal position. The 4 bearing collar set screws must be loosened and if there are split collars on the axle between the bearings they should be removed. Then axle may be moved so there is equal space between the outer bearing collar and the wheel on each end.

The Split Collar Spacer is installed between the wheel and the outer bearing collar. See Figure 2 on Page 3. Some of the 1/16" shims installed on the axle may have to be removed to install the Split Collar Spacer. After the Split Collar Spacer is installed, there should be 1/16" or less of clearance between the shims/Split Collar Spacer and the wheel or bearing. Tighten the screws on the Split Collar Spacer and the bearing collar setscrews.

WARRANTY: None



Figure 122553251 (3") Split Collar Spacer
22553252 (3-7/16") Split Collar Spacer

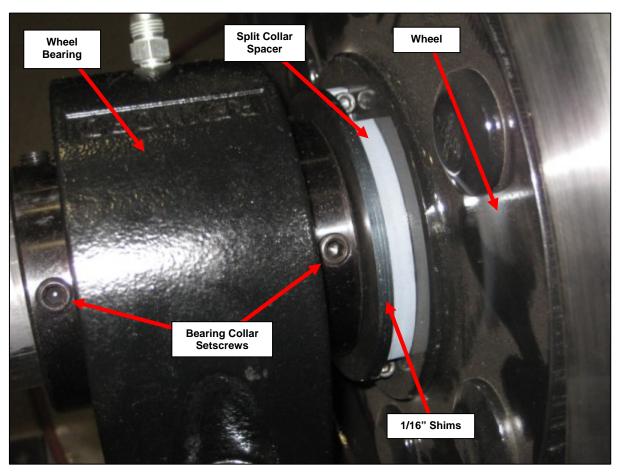


Figure 2
Split Collar Spacer Assembled on Axle (typical both ends)